



Complete Vehicle Inspection, Valuation & History Report

POWERED BY THE PRICE360[®] ENGINE

2018 AUDI S5

VIN: WAUC4CF58JA031138

Power: Gasoline

Type: Hatchback

Drivetrain: AWD

Engine: Intercooled Turbo Premium
Unleaded N/A

Age: 8 years old



Vehicle Story At-A-Glance

The 2018 Audi S5 3.0T Premium Plus boasts an impressive array of features. Its powerful 3L V-6 354hp intercooled turbo engine and 8-speed Tiptronic automatic transmission with overdrive provide exhilarating performance. Safety is a top priority with 4-wheel anti-lock brakes, side seat mounted airbags, overhead airbags, and a driver and passenger knee airbag. The Audi S5 also ensures comfort with automatic air conditioning and 18" aluminum wheels. Other notable features include cruise control, ABS and driveline traction control, and the renowned quattro all-wheel drive system. Experience the unparalleled luxury and performance of the 2018 Audi S5 3.0T Premium Plus.



ODOMETER

90,197 mi



OWNERSHIP

4 Owners



LAST AUCTION

N/A



ACTION REQUIRED

1 Recall

Mileage Health · 90,197 mi

Average



90,197 mi

BELOW AVG · < 70K


TYPICAL · 70-105K

HIGH · 105K+

OPTICAR MARKET VALUES

Market Values	Trade In	Private Party	Retail
Base Value	\$20,808	\$23,152	\$24,957
Recondition Costs	\$2,681	\$2,681	\$2,681
Net Value	\$18,127	\$20,471	\$22,276

Vehicle Damage Assessment

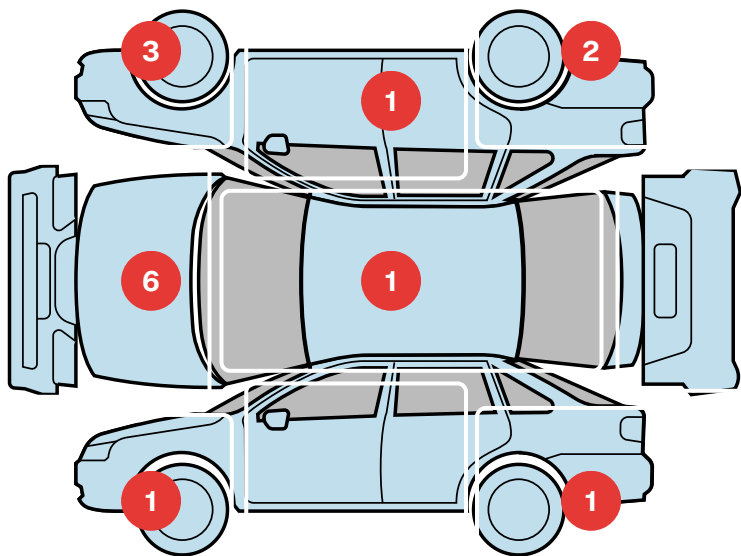

Reconditioning Cost Summary			
Location	Severity	Repair	Cost
B structural pillar (a/b/c/d)	SEV1 - Cosmetic	Compound+polish	1 x \$69
Center 2nd-row seat (rear/bench)	SEV1 - Cosmetic	Interior cleaning	1 x \$53
Front bumper	SEV2 - Minor	Panel respray (consolidated)	1 x \$998
Front hood/bonnet	SEV2 - Minor	Touch-up	1 x \$115
Front hood/bonnet	SEV2 - Minor	Touch-up	1 x \$153
Front left aluminium rim/alloy wheel	SEV2 - Minor	Rim refinish	1 x \$130
Front right aluminium rim/alloy wheel	SEV2 - Minor	Rim refinish	1 x \$122
Front right aluminium rim/alloy wheel	SEV2 - Minor	Rim refinish	1 x \$130
Front right door	SEV2 - Minor	Wet sand+polish	1 x \$138

Left rear aluminium rim/alloy wheel	SEV2 - Minor	Rim refinish	1 x \$130
Rear right aluminium rim/alloy wheel	SEV2 - Minor	Rim refinish	1 x \$130
Rear right rocker/sill/side skirt	SEV2 - Minor	Wet sand+polish	1 x \$115
Right mirror cover/cap/shell	SEV2 - Minor	Touch-up	1 x \$115
Seat (front)	SEV1 - Cosmetic	Detailing	1 x \$53
Seat (front)	SEV2 - Minor	Spot repair	1 x \$230
Total Repair Cost			\$2,681

Reconditioning Details

Front Section



Seat (front)


Type: Seat tear

Severity: SEV2 - Minor

Repair: Spot repair

\$230

Description: A small tear is present on the quilted Alcantara insert of the front seat cushion. Upholstery spot repair is recommended to restore the surface and prevent further tearing.

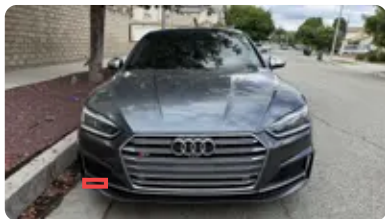

Front bumper


Type: Respray

Severity: SEV2 - Minor

Repair: Panel respray (consolidated)

\$998

Description: Panel respray — 6 paint-related findings on PRC: bumper scuff, scratch, scuff.

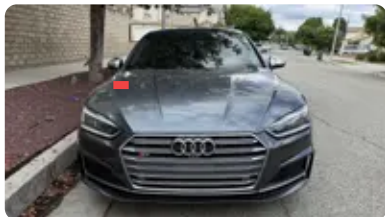

Front hood/bonnet

Type: Paint chip

Severity: SEV2 - Minor

Repair: Touch-up

\$115

Description: A small paint chip is present on the leading edge of the hood, exposing the primer. Cleaning and applying touch-up paint is recommended to prevent rust.



Front hood/bonnet

Type: Paint chips

Severity: **SEV2 - Minor**

Repair: Touch-up

\$153

Description: Multiple small paint chips on the leading edge of the hood, exposing primer. Recommend cleaning and applying touch-up paint to protect the metal.



Seat (front)

Type: Stain

Severity: **SEV1 - Cosmetic**

Repair: Detailing

\$53

Description: A dark stain is visible on the center alcantara insert of the front seat cushion. This cosmetic blemish requires professional steam cleaning and detailing to restore the upholstery's appearance.



B structural pillar (a/b/c/d)

Type: Scratch

Severity: **SEV1 - Cosmetic**

Repair: Compound+polish

\$69

Description: Light surface scratches and scuffs on the painted B-pillar door jamb near the striker plate. These are cosmetic clear coat scratches that can be resolved with a light wet sand and polish.

Front Left Corner



Front left aluminium rim/alloy wheel

Type: Curb rash

Severity: **SEV2 - Minor**

Repair: Rim refinish

\$130

Description: Minor curb rash and scuffing along the outer edge of the rim. Professional refinishing is recommended to restore the clean cosmetic appearance.

Front Right Corner



Front right aluminium rim/alloy wheel


Type: Curb rash

Severity: **SEV2 - Minor**

Repair: Rim refinish

\$130

Description: Curb rash and scuffing on the outer edge of the alloy wheel. Rim refinishing is recommended to restore the appearance before retail sale.

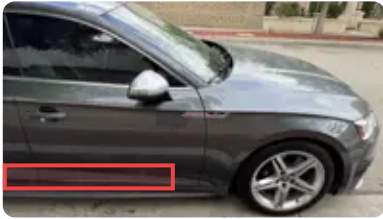

Front right door

Type: Scratch

Severity: **SEV2 - Minor**

Repair: Wet sand+polish

\$138

Description: Light scratch along the lower edge of the front right door panel. The scratch is superficial but visible, requiring a light wet sand and polish to restore the finish.



Front right aluminium rim/alloy wheel

Type: Wheel scuff


Severity: **SEV2 - Minor**

Repair: Rim refinish

\$122

Description: Minor curb rash and scuffing along the outer lip of the front right alloy wheel. The damage is cosmetic and can be repaired with a standard wheel refinishing service.

Right Side

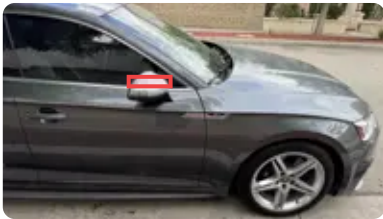

Right mirror cover/cap/shell

Type: Paint chip

Severity: **SEV2 - Minor**

Repair: Touch-up

\$115

Description: Small paint chips and light pitting on the forward-facing surface of the right side mirror cover. Recommend touch-up paint to prevent further degradation and improve appearance.

Rear Left Corner



Left rear aluminium rim/alloy wheel

Type: Curb rash

Severity: **SEV2 - Minor**

Repair: Rim refinish

\$130

Description: Minor curb rash on the outer lip of the rear left alloy wheel, located near the bottom right edge. Recommend wheel refinishing to restore the silver finish.

Rear Right Corner



Rear right aluminium rim/alloy wheel

Type: Curb rash

Severity: **SEV2 - Minor**

Repair: Rim refinish

\$130

Description: Curb rash and scraping along the outer lip of the rear right alloy wheel. Professional wheel refinishing is recommended to smooth the metal and restore the silver finish.



Rear right rocker/sill/side skirt

Type: Scuff

Severity: **SEV2 - Minor**

Repair: Wet sand+polish

\$115

Description: Minor scuffing along the lower edge of the rear right rocker panel. Recommend wet sanding and polishing to clean up the surface.

Roof



Center 2nd-row seat (rear/bench)

Type: Stain

Severity: **SEV1 - Cosmetic**

Repair: Interior cleaning

\$53

Description: A light-colored smudge or stain is visible on the center backrest of the rear seat. Professional interior cleaning and detailing are recommended to restore the appearance.

Vehicle History Overview



TITLE CHECK

No Issues Found



OWNERSHIP HISTORY

4 owners



ACCIDENTS

No accidents found



ODOMETER

90,197 mi



OPEN RECALLS

1 recall



DETAILED HISTORY

36 events



INSURANCE & LIEN
1 record



AUCTION RECORDS
No auction records found



SPECIFICATIONS
Data is available

Title Check

 No fire title

 No hail title

 No flood title

 No junk or scrapped title

 No manufacturer buyback

 No lemon title

 No salvage title

 No rebuilt or rebuildable title

 No odometer title (EML o

Ownership History

OWNER	STATE	PERIOD	PURCHASED	DURATION
OWNER 01	NV	10/2017 - 11/2019	2017	2 y 1 m
OWNER 02	NV	11/2019 - 10/2022	2019	2 y 11 m
OWNER 03	NV	10/2022 - 04/2024	2022	1 y 6 m
OWNER 04 - CURRENT	CA	04/2024 - Present	2024	2 y 3 m+

Open Recalls

	RECALL	COMPONENT	ISSUED
	N/A / 74E3	Safety	11/23/2021

Accidents

No records found

Odometer

DATE	MILEAGE
10/12/2017	202 mi
09/27/2019	15,233 mi
10/03/2019	15,263 mi
11/21/2019	15,273 mi
07/09/2022	41,891 mi
11/03/2022	41,950 mi
01/08/2024	47,997 mi
01/15/2024	47,997 mi
01/22/2024	47,997 mi
01/22/2024	48,275 mi
01/22/2024	49,263 mi
03/28/2024	49,263 mi
04/09/2024	49,853 mi
07/03/2024	54,093 mi
03/16/2026	90,197 mi

Detailed History

2017

10/12/2017	 Independent Source Vehicle Manufactured and Shipped to Dealer	
10/12/2017	 Federal Motor Vehicle Records Odometer Reading from DMV 202 mi	CA
10/24/2017	 Federal Motor Vehicle Records Title(Lien Reported)	APPLE VALLEY, CA
10/24/2017	 Federal Motor Vehicle Records Registration Event/Renewal	CA

2018

10/15/2018	 Federal Motor Vehicle Records Registration Event/Renewal	HENDERSON, NV
11/06/2018	 Federal Motor Vehicle Records Registration Event/Renewal	CA

2019

09/27/2019	 Service Record Vehicle Inspected Emission System Serviced Vehicle Recall Service Performed Suspension Serviced Tires or Wheels Service Performed Promotional Service Performed 15,233 mi	NV
10/03/2019	 Service Record Vehicle Detailed 15,263 mi	NV
10/14/2019	 Federal Motor Vehicle Records Title(Lien Reported)	CA
10/24/2019	 Federal Motor Vehicle Records Vehicle in Dealer Inventory	HENDERSON, NV

10/28/2019	 Service Record Vehicle Detailed	NV
11/04/2019	 Federal Motor Vehicle Records Registration Event/Renewal	LAS VEGAS, NV
11/21/2019	 Federal Motor Vehicle Records Title(Lien Reported) 15,273 mi	LAS VEGAS, NV
2020		
09/11/2020	 Federal Motor Vehicle Records Title(Lien Reported)	LAS VEGAS, NV
11/05/2020	 Federal Motor Vehicle Records Registration Event/Renewal	LAS VEGAS, NV
2021		
02/22/2021	 Federal Motor Vehicle Records Registration Event/Renewal	LAS VEGAS, NV
11/03/2021	 Federal Motor Vehicle Records Registration Event/Renewal	LAS VEGAS, NV
11/23/2021	 Manufacturer Manufacturer Recall Mfr. Recall 74E3 Safety Recall: PASSENGER OCCUPANT DETECTION SYSTEM (POD) LOCATE YOUR NEAREST AUTHORIZED AUDI DEALERTO SCHEDULE REPAIR. Status: Remedy Unknown	
2022		
07/09/2022	 Service Record Vehicle Detailed 41,891 mi	NV
07/14/2022	 Service Record Vehicle Serviced or Inspected	NV
07/15/2022	 Service Record Vehicle Serviced or Inspected	NV

08/30/2022	 Service Record Vehicle Serviced or Inspected	NV
10/17/2022	 Federal Motor Vehicle Records Registration Event/Renewal	LAS VEGAS, NV
11/03/2022	 Federal Motor Vehicle Records Title(Lien Reported) 41,950 mi	LAS VEGAS, NV
2023		
09/20/2023	 Federal Motor Vehicle Records Title(Lien Reported)	LAS VEGAS, NV
2024		
01/08/2024	 Auto Auction Reported at Auto Auction 47,997 mi	DESERT SOUTHWEST REGION
01/15/2024	 Auto Auction Auction Announced as Fleet/Lease(COLOR REPORTED AS GREY) 47,997 mi	DESERT SOUTHWEST REGION
01/22/2024	 Dealer Listing Vehicle Listed for Sale 47,997 mi	ONLINE DEALER
01/22/2024	 Dealer Listing Vehicle Listed for Sale 48,275 mi	VAN NUYS, CA
01/22/2024	 Dealer Listing Vehicle Listed for Sale 49,263 mi	VAN NUYS, CA
03/28/2024	 Federal Motor Vehicle Records Odometer Reading from DMV 49,263 mi	CA
04/09/2024	 Federal Motor Vehicle Records Passed Emission Inspection 49,853 mi	CA

04/17/2024	 Federal Motor Vehicle Records Title(Lien Reported) Registration Event/Renewal	WOODLAND HILLS, CA
07/03/2024	 Independent Repair Center Multiple Point Vehicle Inspection Lube, Oil And/Or Filter Changed 54,093 mi	CANOGA PARK, CA
2025		
01/10/2025	 Federal Motor Vehicle Records Registration Event/Renewal	WEST HILLS, CA
2026		
03/16/2026	 Federal Motor Vehicle Records Passed Emission Inspection 90,197 mi	CA
36 events on record		

Insurance & Lien Records

- No insurance loss record
- No auction lemon/manufacturer buyback record
- No grey market title record
- No repossessed record
- No duplicate title record
- No titled to an insurance company record
- No abandoned title record
- Loan/lien record
- No corrected title record
- No theft record

Auction Records

No auction records found

Vehicle Specifications



Steering

Type	Rack-Pinion
------	-------------



Braking

Type	4-Wheel Disc
Primary Abs System	4-Wheel
Front Disc	Yes
Rear Disc	Yes



Electrical

Cold Cranking Capacity Amps	420
Max Alternator Capacity Amps	150



Suspensions

Front Type	Multi-Link
Front Type Extended	Multi-Link
Rear Type	Multi-Link
Rear Type Extended	Multi-Link



Seating

Number Of Seats	5
Max Seating Capacity	5



Wheels

Front Wheel Material	Aluminum
Rear Wheel Material	Aluminum
Spare Wheel Material	Steel



Tires

Front Tire Size	P245/40YR18
Rear Tire Size	P245/40YR18
Spare Tire Size	Compact
Type	Performance
Front Tire Pressure Psi	36
Rear Tire Pressure Psi	36



Engine

Type	Intercooled Turbo Premium Unleaded N/A
Code	STDEN
Cylinders Configuration	V-6
Displacement	3000
Compressor	Intercooled turbo
Drivetype	AWD
Engine Location	Front
Valves	24
Compression	11.2
Block Type	V



Fuel

Type	Gasoline
Grade	Premium Unleaded



Mpg

Epa City Economy	21
Epa Hwy Economy	30
Epa Combined Economy	24



Electric Powertrain

Limited Slip Differential	Electro-mechanical
---------------------------	--------------------



REPORT dd98ceed-3fba-414f-b174-8cb5f73beba9

THIS OPTICAR® VEHICLE HISTORY REPORT IS COMPILED FROM MULTIPLE THIRD-PARTY SOURCES (INCLUDING STATE DMVS, AUCTIONS, INSURERS, SERVICE/REPAIR FACILITIES, MANUFACTURERS, LAW-ENFORCEMENT RECORDS, AND DATA AGGREGATORS). OPTICAR® INC. RELIES ON THESE SOURCES FOR ACCURACY AND COMPLETENESS. THE INFORMATION MAY BE INCOMPLETE, DELAYED, OR CONTAIN ERRORS OR OMISSIONS AND IS SUBJECT TO CHANGE WITHOUT NOTICE. OPTICAR® DOES NOT INDEPENDENTLY VERIFY ALL DATA. THIS REPORT IS PROVIDED "AS IS" AND "AS AVAILABLE." OPTICAR® AND ITS AFFILIATES, LICENSORS, AND AGENTS DISCLAIM ALL WARRANTIES, EXPRESS OR IMPLIED. THIS REPORT IS NOT A GUARANTEE OF A VEHICLE'S CONDITION, HISTORY, TITLE, MILEAGE, EQUIPMENT, OR VALUE; IT IS NOT AN APPRAISAL, INSPECTION, WARRANTY, TITLE GUARANTEE, INSURANCE POLICY, OR LEGAL/FINANCIAL ADVICE. RECONDITIONING COST ESTIMATES, IF INCLUDED, REFLECT WHOLESALE VALUES TYPICALLY AVAILABLE TO DEALERSHIPS; ACTUAL RETAIL CONSUMER PRICING AND REPAIR COSTS MAY BE HIGHER. USERS SHOULD PERFORM INDEPENDENT INSPECTIONS AND VERIFICATIONS BEFORE ANY TRANSACTION. ALL TRADEMARKS ARE PROPERTY OF THEIR RESPECTIVE OWNERS. © 2026 OPTICAR.AI. ALL RIGHTS RESERVED.